



Service Tips

Error Code 'C01D' on UTY-RNBYU Wired Remote

The CO1D error code is an incompatibility error code between a newer generation wired remote (UTY-RNBYU) and older generation evaporator. The two are compatible with each other but require dip switches to be changed with on the back of the wired remote.

Affected models:

•9CQ •18CL

•9RO •18RL

•9RLQ •18RLQ

•9RL •18RLX

•15RLQ •18RLXS

•24RL •24CL

•24RLQ •30CLX

•24RML* •30RLXQ

•24RML1* •30RLX

•24RLX •36CLX

•24RLXQ •36RML*

•36RML1* •42RLX

•9R2 •36RLX

•12R2 •24CL1

•36CLX1 •30LCX1

DS₁

DS₂

*Excludes all 'RML' cassette models.

* Factory setting

Switch state NO. OFF ON 1 2 DIP 3 switch 1 4 5

Back of wired remote

Power needs to be turned off first on outdoor disconnect. Dip switches to be changed from 'OFF to 'ON' are:

#'s 1, 5, & 6 and are located on DS1.

**Please note: dip switches do not need to be changed for 9RLS, 12RLS, or 15RLS

In order to perform some of these tests an electrical and/or refrigerant license is required. We strongly advise to check the Service manual for more detailed explanation. If you are not sure about these recommendations please contact us at 866-952-8324